

# SOUTHERN CONCRETE CONSTRUCTION CO., INC.

PO Box 50157 · 733 Liberty Expressway SE · Albany, GA 31703-0157 · (229) 435-0786 - Fax (229) 434-4755

Project: Barneyville Rd. at Big Branch Culvert Repairs  
Location: Cook County, GA  
Date of Quote: 09/29/2022

Southern Concrete Construction Co., Inc. (SCC) is pleased to present you with this proposal for the repairs of the structural deficiencies on the above-referenced project. This proposal is based on the site visit on 9/28/2022 and observation of the deficiencies on the structures and is subject to the terms and conditions listed below.

## QUOTATION

<u>Structure ID Number</u>	<u>Location</u>	<u>Lump Sum Repair Total</u>
075-5032-0	Barneyville Rd. at Big Branch	\$82,250.00

## INCLUSIONS FOR ALL QUOTED ITEMS (IF APPLICABLE)

1. Quoted items include all labor, equipment, and material necessary to construct and/or install the items in accordance with current GDOT bridge maintenance specifications.
2. Mobilization is included in the quoted price and provided for our work only.

## EXCLUSIONS FOR ALL QUOTED ITEMS (IF APPLICABLE)

The following work is not covered by this quotation.

1. Erosion Control
2. Drainage items except where quoted
3. Paving
4. Guardrail
5. Striping
6. Signs
7. Utility relocation
8. Permits and Fees

## GENERAL CONDITIONS

1. The job site(s) shall be accessible for our personnel and equipment. The job site(s) shall also have adequate room for parking equipment and storing materials. The job site(s) shall be adequately protected from traffic intrusion.
2. All utilities shall be removed, relocated, or protected prior to our work beginning.
3. Engineering and layout are provided for our work only.
4. Traffic control at each location is included in the quoted price. This total is based on Barneyville Rd. remaining open to the traveling public and flagman stations utilized.
5. Prices are good for 60 days.


GENERAL NOTES:

BOX CULVERT 075-5032-0 Barneyville Rd. at Big Branch:

1. Work to be performed:
  - a. Installation of two (2) wingwalls at the outlet end of the culvert barrel.
  - b. Repair erosion and washed areas around the culvert barrel and wingwalls.
  - c. Install new culvert apron with a vinyl sheeting toe wall at the outlet end of the culvert.
  - d. Install 5' wide Type I Rip Rap apron outlet end of the culvert.
  - e. Repair undermining under the culvert barrel by filling the void with flowable fill.
2. SCC anticipates approx. 10 CY of flowable fill will be required to sufficiently repair the voids at these areas and is included in the quoted price. Any grout required that exceeds 10 CY will be priced at \$900.00/CY.

Please feel free to contact us for any questions, concerns, or clarification. Thank you for the opportunity to quote this work.

Sincerely,

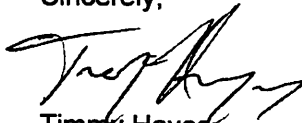

Timmy Hayes  
Southern Concrete Construction Co., Inc.